Historic Preservation Commission Staff Report

Meeting Date: October 8th, 2025

Case #: HPC-52-25

Site Address: 2007 Maxie Thomas Way Parcel ID: 31-05-22-4-014-002.000

Applicant:James WaltmanOwner:James Waltman

Proposed Work: Petition for a Certificate of Appropriateness for the removal of

two trees on the property located at 2007 Maxie Thomas Way in

the Druid City Historic District. (Council District 4).

Current Zoning: DHE-H

Historic District: Druid City
Architectural Style: Queen Anne

Year Built: 1900 Contributing: N/A

Historic Survey: Druid City

Resource 104. 2007 11th Street. Circa 1900. One story, brick veneer Queen Anne cross gable cottage with roof of asphalt shingles, front gable with vent, off center single leaf six panel door, pedimented stoop with decorative iron supports, partial width enclosed porch with shed roof, denticulated cornice, and 6/6 double hung sash windows. NC (Photo #19)

The former residence has been altered. Brick now clads the original weatherboard siding. The porch was enclosed. A window on the façade was replaced with a door. The pedimented stoop is not original (Sanborn Map Company 1923).

DESCRIPTION OF PROPOSED PROJECT:

The petitioner proposes to remove 2 mature pecan trees on the property. Per the petitioner, the trees are causing damage to the foundation. The petitioner states that both trees are within three feet of the principal structure.

STAFF ANALYSIS:

The design guidelines specify that large trees should only be removed if they are severely diseased, damaged, or pose an immediate threat to people or property.

APPLICABLE DESIGN GUIDELINES:

E. Landscape and Plant Materials

- Design and install landscape plantings to maintain the overall continuity and aspect of the district. Look at patterns that exist and work with those patterns.
- Maintain and/or enhance the historic plant materials, mindful of the differences in scale and types of landscaping relative to the size, age and use of the buildings, insofar as practicable.
- Specify and locate trees to avoid conflict with or damage to buildings, sidewalks and driveways.
- When appropriate, retain and preserve the building and landscape features that
 contribute to the overall historic character of the district, including trees, gardens, yards,
 arbors, groundcovers, fences, accessory buildings, patios, terraces and fountains, fish
 ponds, and significant vistas or views.
- Retain and preserve the historic relationship between buildings and landscape features on the site. It is not recommended to alter the topography of substantially through grading, filling or excavation.
- Replace seriously diseased or severely damaged trees (as defined by Sec. 24-252 of the Zoning Ordinance) or hedges with new trees or hedges or equal or similar species.
- Large canopy trees (12" dbh) should not be removed unless seriously diseased or severely damaged or if it poses immediate threat to persons or property.



Certificate of Appropriateness Application

Property Information:

Site Address:

2007 Maxie Thomas Way, Tuscaloosa, Alabama 35401

Historic District: Estimated Cost of Construction:

Druid City 6500

Detailed Description of the Proposed Work:

There are two mature pecan trees, one on each side of the house, that are directly contributing to foundation damage. Both trees are located within three feet of the structure (see attached photographs). In addition to the below-ground risks from their root systems, both trees have large overhanging limbs that pose a serious hazard to the home. The property is exposed to two significant threats: falling limbs from above and continued foundation compromise from below.

The licensed home inspector has documented the existing foundation issues, and excerpts from the inspection report are included below. In addition, the tree service has noted the recurring problem of pecan trees dropping heavy limbs.

For these reasons, we strongly recommend the removal of both trees to protect the structural integrity and safety of the home.

Detailed Description of the Proposed Materials:

Ellison Tree Service will do the work. ETS is a reputable tree service with the equipment needed to handle these trees.

Applicant Information:

Applicant Name:

James Waltman

Is the applicant also the property owner? Yes

Supporting Documents:

Site Plan:

Elevation Drawings:

TDO Tree1.JPG

TDO Tree2.JPG

TDO Tree3.JPG

Proposed Materials Documents:

Additional Documents:

Screenshot 2025-09-19 at 9.50.42 AM.png

Once submitted, a staff member will contact the applicant using the email provided on this form. If more documents are required, the staff member will clarify what is required in that email. By submitting this application, you recognize the city will send public notification and place a sign on the property with information for the public.

2007 Maxie Thomas Way, Tuscaloosa, AL August 27, 2025

SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR

REFERENCE



15. Mortar deterioration

FOUNDATIONS \ General notes

5. Condition: • Cracked

Significant cracks are noted at the right & left side brick veneer. There could be multiple reasons for the cracks, but I would assume the roots from the pecan trees are to blame. I recommend this tree be removed Implication(s): Chance of water damage to structure, finishes and contents I Weakened structure

Location: Right Side Exterior Wall

Task: Remove Trees **Time**: Immediate







2007 Maxie Thomas Way, Tuscaloosa, AL August 27, 2025

SUMMARY

ROOFING

RIOR

STRUCTURE

ELECTRICA

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR


REFERENCE



18. Cracked



19. Cracked

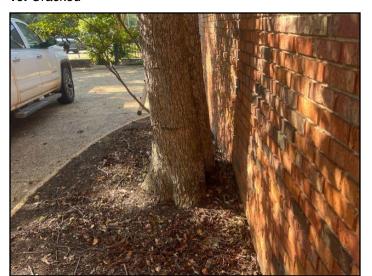

20. Cracked

21. Cracked

STRUCTURE Report No. 4149

2007 Maxie Thomas Way, Tuscaloosa, AL August 27, 2025

SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INT

REFERENCE



22. Cracked

FOUNDATIONS \ Beams (Girders)

6. Condition: • Insect damage

Severe insect damage is noted at the right side beam that supports the entire wall. Similar damage is noted at the beam between the front room and the entrance to the left side hallway. This amount damage could lead to sagging floors and failing support structure. I recommend a structural engineer or general contractor for evaluation

Implication(s): Material deterioration
Location: Right Side Exterior Wall

Task: Further evaluation by a ST ENG/Contractor


Time: Immediate




23. Insect damage



24. Insect damage

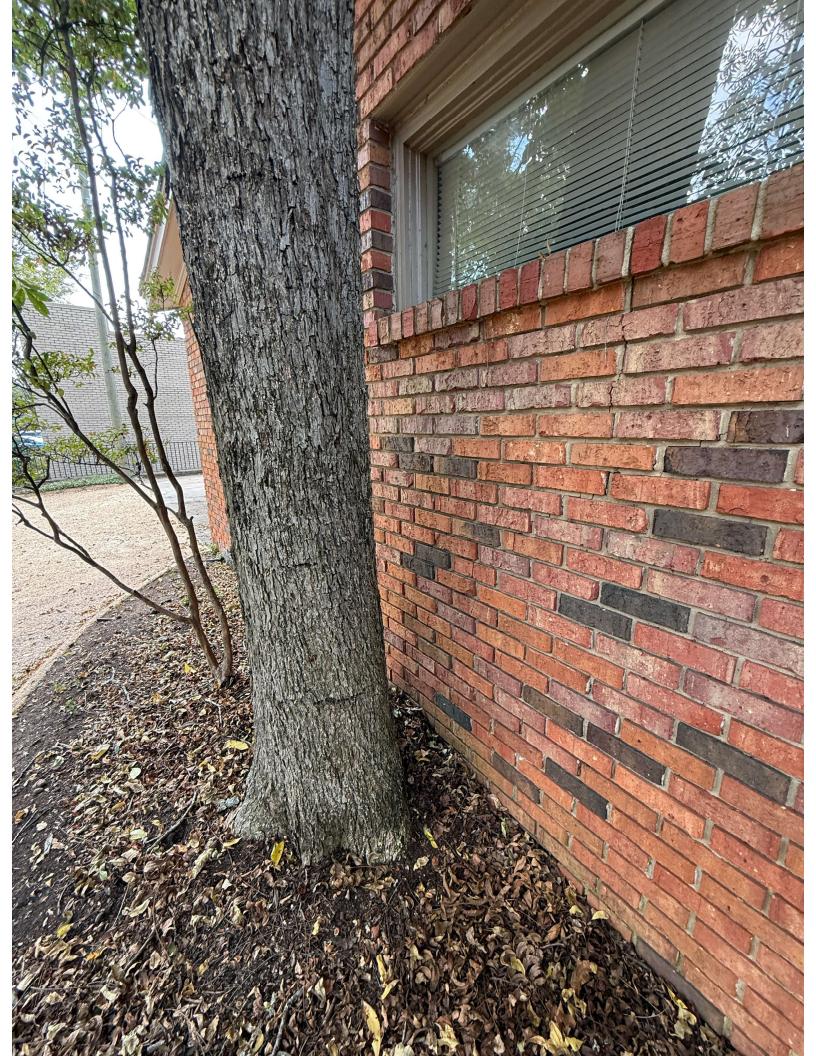



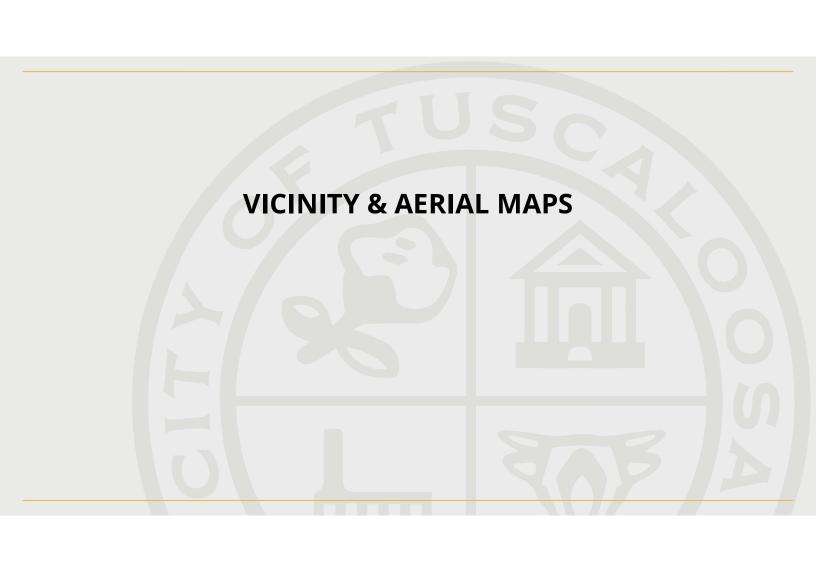




2007 Maxie Thomas Way

1 inch = 50 feet 0 25 50 75 100 Feet






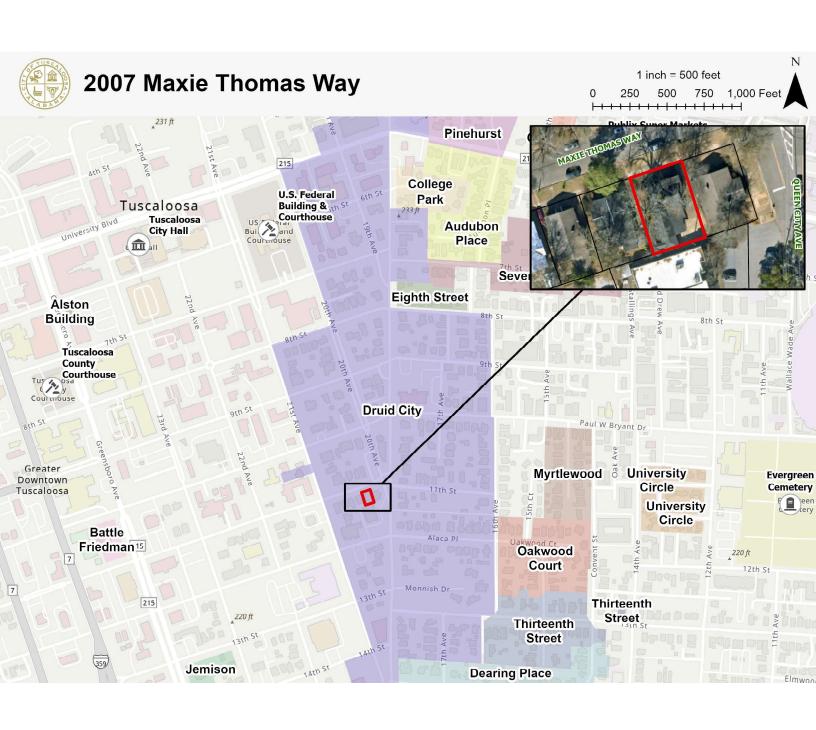







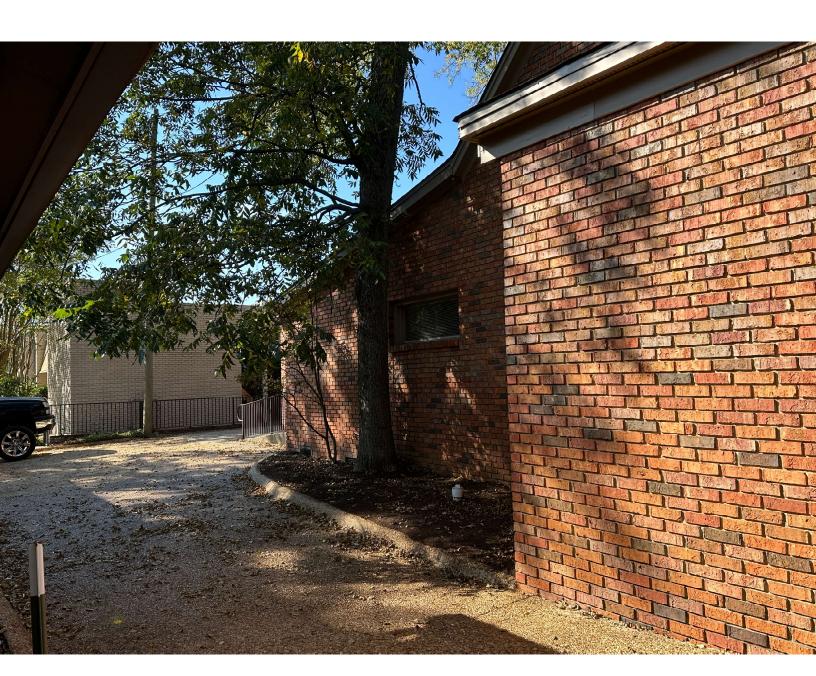

STAFF PHOTOS OF ADJACENT PROPERTIES





